




1020 S.Sangamon Ave. Gibson City, IL 60936

Ph# (217) 784-4261

Fax# (217) 784-1093

INFORMATION BULLETIN

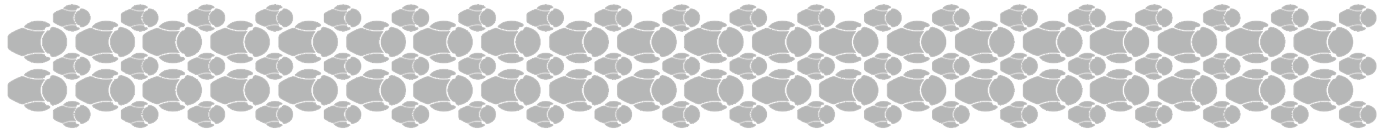

Products affected: TS12

Complaint: Main driveline disengages from tractor PTO output shaft. Main driveline becomes bent at the profile overlap.

Cause: Main driveline profile is galling from lack of lubrication.

Correction: Lubricate profile at specified interval indicated in owner's manual. May be necessary to unhook driveline from tractor and telescope the profile "out" to expose lube fitting.

Reference Part: 00790233 Main Driveline

Labor hours: Information only; No labor